Appendix 9: Preliminary Site Investigation Levi Road

Soil Contamination Risk Preliminary Site Investigation Report

131-139 Levi Road, 274 & 294 Lincoln Rolleston Road, Rolleston

January 2021
Revision 1







19 Robertsons Road, Kirwee RD1, Christchurch 7671 021 132 0321 www.mallochenviro.co.nz

QUALITY CONTROL AND CERTIFICATION SHEET

Client: Four Stars Developments

Status: Revision 1 to address request for further information (RFI) from Selwyn District Council

Date of issue: 29 January 2021

Report written by:

Fran Hobkirk, Environmental Scientist, BSc (4 years contaminated land experience)

Signed: Kyobkin

Report reviewed and certified as a Suitably Qualified and Experienced Practitioner by:

Nicola Peacock, Principal Environmental Engineer, NZCE, CEnvP

(12 years contaminated land experience within 28 years environmental experience)

Signed: MR fearon

CONTENTS

1	Executive Summary				
2	Objectives of the Investigation				
3	Scope of Work Undertaken				
4	Site Identification				
5	Site Description and Surrounding Environment				
6	Geology and Hydrology				
7	Site History				
	7.1	Previous Site Ownership and Use	6		
	7.2	District Council Records	7		
	7.3	Regional Council Records	7		
	7.4	LINZ Records	8		
	7.5	Review of Historic Aerial Photographs	8		
8	Site Inspection				
9	HAIL Uses and Possible Types of Contaminants Associated with Past Use				
10 Basis for Soil Guideline Values (SGV)			15		
	10.1	Activity Description	15		
	10.2	Zoning	15		
	10.3	Soil Guideline Values	15		
11	Site Characterisation and Conclusion				
12	Planning Status				
13	Limitations				

APPENDICES

- A Historic Certificates of Title
- B Historic Aerial Photographs
- C LLUR Statement
- D Site Inspection & Risk Area Plan

1 Executive Summary

The subject site involves three lots between Levi Road and Lincoln Rolleston Road in Rolleston. It is proposed to rezone the site to allow residential use. This will involve a change in use, future subdivision and potential disturbance of soils in the future. The Resource Management (National Environmental Standard for Assessing and Managing Contaminants in Soil to Protect Human Health) Regulations 2011 (NESCS) do apply to the subject site and require an assessment of the likelihood of soil contamination being present. It is noted also that Malloch Environmental Ltd is obligated to consider the requirements of Section 10 of the Health and Safety at Work (Asbestos) Regulations 2016. This report details the work undertaken to assess the risks.

This investigation has determined the subject site has had a general pastoral use until 1994 when Lot 1 and Lot 2 DP 67190 were developed for rural residential use. Lot 2 DP 322710 was developed for use as a horse-racing stable and rural residential use from 2006. Two risk areas have been identified on Lot 1 DP 67190. A possible burn area was noted on the western paddock on the 2012 aerials and another burn area was noted on the 2019 aerial. The newer burn area was confirmed to be a waste/burn pile during the site inspection. These pose a risk of contamination by heavy metals. The locations of the risk areas are shown on the Site Inspection & Risk Area Plan in **Appendix D**. These are confirmed or likely Hazardous Activities and Industries List (HAIL) activities and there may be a risk to human health from potentially contaminated soils in these areas. It is recommended that a Detailed Site Investigation, in terms of the Ministry for the Environments Contaminated Land Management Guidelines, be undertaken on the identified risk areas prior to any change of use or development.

For the purposes of the current plan change proposal, the identified HAIL activities/risks are not likely to preclude eventual subdivision of the land. As each stage of the plan change area is developed, an updated PSI with site inspections should be provided along with DSI as required.

In terms of planning status at the time of writing of this report, the NESCS does apply to the identified risk area and resource consent under the NESCS would be required for future subdivision and activities controlled by the NESCS.

2 Objectives of the Investigation

This report has been prepared in accordance with the Ministry for the Environment's "Contaminated Land Management Guidelines No 1: Reporting on Contaminated Sites in New Zealand". This report includes all requirements for a Stage 1 Preliminary Site Investigation report. This is one of the methods described in Section 6(3) of the NESCS to establish whether the regulations apply. The objective is to determine whether there is any risk of potential contamination that would warrant further investigation.

3 Scope of Work Undertaken

The scope of the work undertaken has included:

- Review of Selwyn District Council property files
- Obtaining ECan data from the Listed Land Use Register (LLUR)
- Search of LINZ NZ orchard database
- Review of historic aerial photos
- Review of historic titles
- Preparation of report in accordance with MfE guidelines

4 Site Identification

The site lies between Levi Road and Lincoln Rolleston Road in Rolleston as shown on the plan in **Figure 1** below. The site consists of three rural residential lots and has a total area of 36.0910Ha. The street addresses, legal descriptions and areas of the lots included in the site are:

Street Address	Legal Description	Area (Ha)
131 & 139 Levi Rd	Lot 2 DP 322710	28.0900
294 Lincoln Rolleston Rd	Lot 1 DP 67190	4.0000
274 Lincoln Rolleston Rd	Lot 2 DP 67190	4.0010
	Total Area	36.0910





Figure 1 – Location Plan

5 Site Description and Surrounding Environment

The subject site is mainly flat rural and rural residential land. Lots 1 and 2 DP 67190 are typical rural residential lots with a dwelling, garage and associated sheds on each lot. Lot 2 DP 322710 has a homestead area with a dwelling at the 139 Levi Road corner of the lot. The rest of the lot is used by a horse-racing stable. There are stable buildings, a staff dwelling and other farm buildings along with paddocks and a training track. The subject site is defined by existing hedges and fences. It is bounded by residential lots to the north and south, to the west and south-east are rural residential lots, to the east is rural land. Rolleston town centre lies approximately 1km to the west.

6 Geology and Hydrology

The ECan GIS describes the soils as a combination of Templeton deep silty loam and Templeton moderately deep silty loam. Soil trace elements are 'Regional, Recent'. Wells in the area indicate that topsoils are underlain by layers of sandy gravels, claybound gravels and gravel.

The site lies over the unconfined/semi-confined gravel aquifer system. Ground water levels recorded on nearby bore logs are between 9.30m and 15.30m deep. The direction of ground water flow is generally in a south-easterly direction. The nearest downgradient well is an irrigation well approximately 24m south of the subject site.

According to Ecan's GIS there are no open water features on the subject site.

7 Site History

7.1 Previous Site Ownership and Use

Historic Certificates of Title were searched and the following relevant ownership information was obtained:

Combined ownership

Dec 1906 - James Wallace, farmer

Undated - Robert John Wallace, farmer and Charles Leslie McCrostie, farm salesman

Dec 1911 - George Kidd Askin, farmer

Oct 1917 - Joseph Lawton Ragg, farmer Jul 1926 - Douglas Edward Taylor, farmer

Jan 1931 - George Taylor, farmer

Mar 1941 - William Albert Taylor, farmer

Jun 1957 - Reginald Henry Butterick, farmer

Dec 1960 - John Henry Butterick, farmer

Lot 2 DP 322710

Oct 1965 - Mary McGill Butterick, widow

Mar 1967 - Mark Thomas Butterick, farmer

Aug 1969 - Brendean Farm Ltd

Aug 1992 - Arthur Ross Bussell, farmer and Noeline Shirley Bussell, married woman

Apr 2002 - Mark Purdon and Vicki Lynnette Purdon

Dec 2011 - Mark Purdon

Jul 2014 - Mark Purdon and Natalie Clair Rasmussen

Lot 1 DP 67190

Oct 1963 - George Morris, horse trainer and Merie Emilie Morris, his wife

Sep 1994 - Alexander Graham Dunlop, farmer and Adrienne Elizabeth Dunlop, his wife

May 1995 - Stephen Roger Chapman, company manager and Nicola Mary Chapman, his wife

Lot 2 DP 67190

Oct 1963 - George Morris, horse trainer and Merie Emilie Morris, his wife

Sep 1994 - Alexander Graham Dunlop, farmer and Adrienne Elizabeth Dunlop, his wife

May 1995 - Kevin John Morland, clerk and Wilhemina Annechiena Gezenia Morland, married woman

Apr 2000 - Alexander James Cook and Pamela Cook

Jan 2008 - Sharon Linda Jones and Canterbury Trustees Ltd

Oct 2016 - Sharon Linda Jones and Emma Grace Louise Jones

Apr 2019 - 2 Degrees Real Estate Ltd

Note that some of the older information was of poor quality and difficult to follow, therefore the accuracy of the spelling of names and dates is not guaranteed. Copies of the Historic Titles are included in **Appendix A**.

7.2 District Council Records

Selwyn District Council provided the following list of building consents that apply to the subject site:

Lot 2 DP 322710

Jan 2013 - Earthquake Repairs

Mar 2008 - Erect a 9 Bay `L-shaped` Farm Building (Stables)

Oct 2007 - Relocated 2 Bedroom Domestic Dwelling

Jul 2007 - Erect a 4 Bedroom Domestic Dwelling

Mar 2007 - Erect a Horse Stable Building with wash down areas and tearoom, laundry with upstairs viewing room and office.

Nov 2006 - Erect a 6-bay Farm Building

Nov 2006 - Erect a Farm Building

Lot 1 DP 67190

Jul 2005 - Erect a 2 Bedroom Domestic Dwelling

Jul 2005 - Erect a Domestic Garage

Jul 2005 - Erect a Domestic Garage/Workshop

Dec 1994 - Erect a Dwelling

Lot 2 DP 67190

Jun 2002 - Erect a Greenhouse

Feb 2001 - Erect a Garage

Jun 2000 - Erect a Greenhouse

Nov 1994 - Erect a Dwelling

As all the consents are modern the full property files were not fully reviewed. The details of building consent 'BC071978 - Relocated 2-bedroom dwelling' were reviewed. This did not involve re-use of an older dwelling. The cottage was built off-site for the purpose of relocation onto 131/139 Levi Road.

7.3 Regional Council Records

Part of the subject site is listed on the ECan Listed Land Use Register Statement, however, it is listed as 'Verified Non-HAIL'. The site was originally listed due to a greenhouse noted on aerial

photographs. However, information from the landowner who erected and operated the greenhouses showed persistent pesticides were not used at the site and the potential HAIL activity was removed and the site updated to 'Verified Non-HAIL'.

No nearby sites are listed.

Five nearby Preliminary Site Investigations are summarised in the LLUR statement. None of those investigations identified potential sources of contamination that could affect the current subject site.

See LLUR Statement in Appendix C.

Resource consent information was sourced from the GIS mapping system. There is an active resource consent for Lot 2 DP 322710 of the subject site to discharge domestic sewage tank effluent into ground. There are active resource consents for adjacent land to discharge stormwater and to take groundwater for irrigation.

7.4 LINZ Records

The LINZ Orchard layer does not show the subject site or any adjacent sites as having listed orchards.

7.5 Review of Historic Aerial Photographs

A total of nine aerial photos (see copies in **Appendix B**) have been used to assess the historic use of the site as detailed below:

- The earliest photo is from **1942** and has been sourced from ECan's GIS. The subject site is in pasture. There are no buildings or structures on the subject site. The surrounding area is mainly similar pasture farmland. There is a dwelling beyond the subject site to the northwest. There is a dwelling and farm sheds approximately 330m south-east of the subject site. A third dwelling is present approximately 390m south-west of the subject site.
- A photo from **1961** is sourced from ECan's GIS and shows no significant changes to the subject site or surrounding area.
- A photo from 1974 is sourced from ECan's GIS and shows a training track is present on one
 of the paddocks of the subject site. There are no significant changes to the surrounding
 area.
- A photo from 1982 is sourced from ECan's GIS and shows no significant changes to the subject site or surrounding area.
- A photo from 1995 is sourced from ECan's GIS and shows dwellings and sheds have been built on Lot 1 and Lot 2 DP 67190. Part of Lot 2 DP 322710 is divided into strips suggesting a possible horticultural use. Two dwellings have been added beyond the subject site to the west. Dwellings have also been built beyond the subject site to the south-west, across Lincoln Rolleston Road.
- A photo from 2000 is sourced from ECan's GIS and shows a greenhouse has been built on Lot 2 DP 67190. Landscaping of the curtilage area on Lot 1 DP 67190 is in progress with some bare earth areas for garden beds and tree planting. The training track that crossed Lot 1 and Lot 2 DP 67190 is now barely visible suggesting it is disused. The possible horticultural activities noted on the previous aerial have ceased and Lot 2 DP 322710 is now in pasture.

- A photo from 2004 is sourced from ECan's GIS and shows a second greenhouse has been built on Lot 2 DP 67190. There are areas of bare earth or possible stockpiles on Lot 1 DP 67190 to the west of the dwelling. Further rural residential development has occurred beyond the subject site to the north and west.
- A photo from **2012** is sourced from ECan's GIS and shows the following changes:
 - Lot 2 DP 67190 the greenhouses have been removed.
 - Lot 2 DP 322710 a dwelling, stables, associated buildings and a horse training track have been added.
 - Lot 1 DP 67190: A second dwelling with adjacent garage has been built to the west of the existing dwelling. The previously noted bare earth/stockpiles in this area have gone. A garage/shed has been built to the south of the existing dwelling. A potential burn area is present in the middle of the paddock to the north-west of the dwellings. Items, possibly firewood, are being stored on the south-west corner of this paddock. A possible stockpile of soil is present on the western end of the north-west boundary of this paddock. A vegetable garden has been added to the northeast of the existing dwelling.
 - Residential development is occurring beyond the subject site to the north-west.
- The most recent aerial photo reviewed, dated **2019**, sourced from ECan's GIS shows no significant changes to Lot 2 DP 322710 or Lot 2 DP 67190. The previously noted potential burn area on Lot 1 DP 67190 is no longer visible. A new potential burn area is present on the paddock to the north-east of the dwellings. The items stored on the western paddock have been removed. Significant residential development has occurred beyond the subject site to the north. More residential development is underway beyond the subject site to the south.

8 Site Inspection

A site inspection was undertaken on the 25th January 2021. As all the properties are still in use and development is not likely to occur for a period of time it is recommended that further site inspections are completed as each stage of the plan change area is developed. Updated PSI and DSI reports can then be produced as required.

294 Lincoln Rolleston Road was inspected in detail to characterise the potential sources of contamination noted on aerial photographs. A Site Inspection Plan of 294 Lincoln Rolleston Road is included in **Appendix D**. No likely sources of contamination have been identified for the other lots on the subject site by the desktop part of this investigation. Access to the other lots was more limited, despite prior notice. The stable yard on 131 Levi Road was accessed but is a working racing stables and at the time of the visit no-one was available to confirm that access further onto the property was safe or permitted. No burn or waste piles were noted on the paddocks at the front of the property. The buildings around the stable yard were modern. The yard had a clean appearance. 139 Levi Road could not be accessed as the electronic gate was locked and no-one responded to the bell.

294 Lincoln Rolleston Road

The buildings toward the front of the site and to the north of the driveway are the weatherboard cottage and domestic garage constructed in 2005. At the end of the driveway is a brick dwelling that was constructed in 1994. To the south of the driveway is a 'Versatile' style 4-door garage. This appears to be the 'garage/workshop' constructed in 2005. There was no evidence of asbestos containing materials on the exterior of any of the buildings. The garage/workshop has

a concrete floor and does not appear to have a commercial use. There was no staining of the gravel driveway or the concrete apron at the front of the garage/workshop.



Photo 1 – Brick dwelling with metal roof tiles



Photo 2 – Garage/workshop with concrete floor

To the rear of the dwelling curtilage area is a vegetable garden with some small sheds and a container. No bulk storage or chemicals or treated timber was seen in this area or anywhere else on the property. There was a pile of natural firewood and a small quantity of treated timber being stored off the ground on shelves.



Photo 3 – Vegetable garden



Photo 4 – Small sheds



Photo 5 – Vegetable garden and refrigeration container



Photo 6 - Small quantity of treated timber, stored off the ground



Photo 7 – Firewood, bricks and some tyres stored on top of bricks

A waste/burn pile is present on the paddock north-east of the dwelling. The pile currently includes a combination of green waste, treated timber, polystyrene, plastic items, mattresses, cardboard and metal items. Although no charred items or ash were seen, it was not possible to view the underlying soils to assess whether any waste had previously been burnt.



Photo 8 - Waste/burn pile

Tarpaulins that appear to have previously contained hay/fodder are present next to the fence between the western and northern paddocks.



Photo 9 – Tarpaulins with sheep droppings and remains of feed

A low stockpile of sandy soil is present towards the western end of the north-west boundary. No demolition debris or waste items were visible on the surface of the pile.



Photo 10 - Stockpile of sandy soil

9 HAIL Uses and Possible Types of Contaminants Associated with Past Use

The Hazardous Activities and Industries List (HAIL) compiled by The Ministry for the Environment include the following categories (*in italics*) that could be associated with the historical uses of the site with a summary of the risk of these activities having been carried out on the site.

A - Chemical manufacture, application and bulk storage

10. Persistent pesticide bulk storage or use including sport turfs, market gardens, orchards, glass houses or spray sheds

The subject site has been used for pastoral activities until 1994 when parts of the site were developed for residential use. The normal use of fertilisers and pastoral weed controls associated with pastoral use is unlikely to have caused soil contamination that would pose a risk to human health. It is considered unlikely that persistent agrichemicals or fuels were used or stored on the site in any significant volume now or in the past.

Possible horticultural activities were noted on the 1995 aerial photograph but gone by the 2000 aerial. The surrounding area isn't known for market gardening activities therefore it is considered most likely that this was a fodder crop or similar rather than intensive horticultural activities. Also, given the modern era of the activity it is unlikely that any persistent pesticides of concern would have been used. Therefore, it is considered highly unlikely that this potential horticultural activity would pose a risk to human health and HAIL A10 is not considered to apply.

G – Cemeteries and waste recycling, treatment and disposal

5. Waste disposal to land

A waste/burn pile was noted during the site inspection of 294 Lincoln Rolleston Road (Lot 1 DP 67190). The pile included waste items such as plastic, metal and furniture. No asbestos containing materials were visible. Another potential burn area was noted on Lot 1 DP 67190 on

the 2012 aerial but not visible on the 2019 aerial and not visible during the site inspection. Contaminants of concern include heavy metals.

A stockpile of sandy soil is present on the western corner of Lot 1 DP 67190. No evidence of demolition debris or waste items were seen in this stockpile during the site inspection. It is considered likely that this is surplus material from the excavation of building foundations or landscaping works on the lot and is therefore unlikely to pose a risk to human health.

I - Any other land that has been subject to the intentional or accidental release of a hazardous substance in sufficient quantity that it could be a risk to human health or the environment

There is no evidence of any buildings or structures being present on the subject site prior to 1994. It is considered highly unlikely that soil contamination from lead-based paint products or asbestos containing materials exists on the subject site in sufficient quantities that would pose a risk to human health.

10 Basis for Soil Guideline Values (SGV)

10.1 Activity Description

This report has been written for the following potential activities:

- Proposed plan change to residential use,
- Future subdivision
- Future soil disturbance activities associated with the above use and development of the site

10.2 Zoning

The subject site is currently zoned Inner Plains.

10.3 Soil Guideline Values

Human health soil contaminant standards for a group of 12 priority contaminants were derived under a set of five land-use scenarios and are legally binding under The Resource Management (National Environmental Standard for Assessing and Managing Contaminants in Soil to Protect Health) Regulations 2011 (NESCS). These standards have been applied where applicable. The regulations describe these as Soil Contaminant Standards. For contaminants other than the 12 priority contaminants, the hierarchy as set out in the Ministry for the Environment Contaminated Land Management Guidelines No 2 has been followed. These are generally described as Soil Guideline Values. For simplicity, this report uses the terminology Soil Guideline Values (SGV) when referring to the appropriate soil contaminant standard or other derived value from the hierarchy. For soil, guideline values are predominantly risk based, in that they are typically derived using designated exposure scenarios that relate to different land uses. For each exposure scenario, selected pathways of exposure are used to derive guideline values. These pathways typically include soil ingestion, inhalation and dermal adsorption. The guideline values for the appropriate land use scenario relate to the most critical pathway.

The land-use scenarios applicable for the proposed use of this site and any associated earth disturbing activities include 'residential 10% produce', and 'commercial /industrial/outdoor workers' as a proxy value to protect the health of construction workers.

11 Site Characterisation and Conclusion

This investigation has determined the subject site has had a general pastoral use until 1994 when Lot 1 and Lot 2 DP 67190 were developed for rural residential use. Lot 2 DP 322710 was developed for use as a horse-racing stable and rural residential use from 2006. Two risk areas have been identified on Lot 1 DP 67190. A possible burn area was noted on the western paddock on the 2012 aerials and another burn area was noted on the 2019 aerial. The newer burn area was confirmed to be a waste/burn pile during the site inspection. These pose a risk of contamination by heavy metals. The locations of the risk areas are shown on the Site Inspection & Risk Area Plan in **Appendix D**. These are confirmed or likely HAIL activities and there may be a risk to human health from potentially contaminated soils in these areas. It is recommended that a Detailed Site Investigation, in terms of the Ministry for the Environments Contaminated Land Management Guidelines, be undertaken on the identified risk areas prior to any change of use or development.

For the purposes of the current plan change proposal, the identified HAIL activities/risks are not likely to preclude eventual subdivision of the land. As each stage of the plan change area is developed, an updated PSI with site inspections should be provided along with DSI as required.

12 Planning Status

In terms of the NESCS section 5 (7) states that the land is considered to be covered if an activity or industry described in the HAIL is being undertaken on it; or has been undertaken on it; or it is more likely than not that an activity is being or has been undertaken on it. Section 6 describes the methods for determining whether the land is as described in section 7. Method 6 (3) is to rely on a Preliminary Site Investigation.

This Preliminary Site Investigation has found that there is evidence of an activity or industry described in the HAIL occurring on a part of the subject site now or in the past. In terms of planning status at the time of writing of this report, the NESCS does apply to the risk area identified on the site and resource consent would be required for future subdivision and activities controlled by the NESCS.

13 Limitations

Malloch Environmental Limited has performed services for this project in accordance with current professional standards for environmental site assessments, and in terms of the client's financial and technical brief for the work. Any reliance on this report by other parties shall be at such party's own risk. It does not purport to completely describe all the site characteristics and properties. Where data is supplied by the client or any third party, it has been assumed that the information is correct, unless otherwise stated. Malloch Environmental Limited accepts no responsibility for errors or omissions in the information provided. Should further information become available regarding the conditions at the site, Malloch Environmental Limited reserves the right to review the report in the context of the additional information.

Opinions and judgments expressed in this report are based on an understanding and interpretation of regulatory standards at the time of writing and should not be construed as legal opinions. As regulatory standards are constantly changing, conclusions and recommendations considered to be acceptable at the time of writing, may in the future become subject to different regulatory standards which cause them to become unacceptable. This may require further assessment and/or remediation of the site to be suitable for the existing or

proposed land use activities. There is no investigation that is thorough enough to preclude the presence of materials at the site that presently or in the future may be considered hazardous.

No part of this report may be reproduced, distributed, publicly displayed, or made into a derivative work without the permission of Malloch Environmental Ltd, other than the distribution in its entirety for the purposes it is intended.





COMPUTER FREEHOLD REGISTER UNDER LAND TRANSFER ACT 1952

Historical Search Copy



Identifier Land Registration District Date Issued **90577 Canterbury**09 May 2005

Cancelled

Prior References

CB3C/219

Estate Fee Simple

Area 28.0900 hectares more or less **Legal Description** Lot 2 Deposited Plan 322710

Original Proprietors

Mark Purdon and Vicki Lynnette Purdon

Interests

5729095.2 Mortgage to Bank of New Zealand - 15.9.2003 at 9:00 am

7569723.1 Variation of Mortgage 5729095.2 - 9.10.2007 at 9:00 am

7884822.1 Transfer to Mark Purdon (1/2 share) and Vicki Lynnette Purdon (1/2 share) - 22.7.2008 at 11:29 am

8389252.1 Discharge of Mortgage 5729095.2 - 21.1.2010 at 12:26 pm

8389252.5 CT 463353 issued - 21.1.2010 at 12:26 pm.

CANCELLED

Reference:

Prior C/T. 232/94 and 93

Transfer No. 611962 N/C. Order No.



NCELLE Dand and Deeds 69

REGISTER

CERTIFICATE OF TITLE UNDER LAND TRANSFER ACT

~October one thousand nine hundred and sixty-three This Certificate dated the 31st day of under the scal of the District Land Registrar of the Land Registration District of

RAYMUND GEORGE MORRIS of West Melton Horse Trainer and MERIE WITNESSETH that EMILIE MORRIS his wife are

is seised of an estate in fee-simple (subject to such reservations, restrictions, encumbrances, liens, and interests as are notified by memorial underwritten or endorsed hereon) in the land hereinafter described, delineated with bold black lines on the plan hereon, be the several admeasurements a little more or less, that is to say: All that parcel of land containing 27 acres 3 roods

perches or thereabouts situated in Block III of the Leeston Survey District 22841 Rural Sections 5943 and 7437 on Deposited Plan No.



Mortgage 611963 31-10-1963 á

Variation of Ward age 611963 - 23/11/1966 at 12.5 page 611963

Mortgage 951599 to Therming to Tark Tand Co-operative 20.7.1994 at 10.35am Terminating Builden's at 2.20 p.m.

Transfer A124464/1 to Alexander Graham Dunlop of Springston, Farmer and Adrienne Elizabeth Dunlop, his wife - 20.7.1994 at 10.35am

Mortgage A124464/2 to ASB Bank Limited -

PLAN No. 67170 LODGED 1118

AND DEPOSITED

No.A136810/1 Certificate pursuant to Section 224(c) Resource Management Act 1991 - 29.9.1994 at 10.33am

OCT A136810/2-4 - Cancelled and CST 39B/869 29.9.1994 871 issued for Lots 1-3 67190 respectivel

CANCELLED DUPLICATE DESTROYED

INCOLN 27, 3.20 METRIC AREA:-11.2806 ha

> 1 inch = 10 chains Scale:



A.L.R.

NEW ZEALAND.



Vol. 232, folio 93

CERTIFICATE OF	TITLE UNDER LAND TRANSFER ACTUELLED
	day of, one thousand nine hundred and, under
the hand and seal of the District Land Registrar of the	Land Registration District of Appendicularity . Mitnesseth that
y problem assessed	Rollendon Danmen
\	
	vations, restrictions, encumbrances, liens, and interests as are notified by memorial underwritten
	of the Crown to take and lay off roads under the provisions of any Act of the General Assembly same is delineated by the plan hereon, bordered 12222 be the several admeasurements
	land containing Warkly Six Otres and All War Arthur
Hanse Wenshaw on Khan	Less sith for W Sarah EV un Sarah ich chen dass
Dunnery Vachnick being V	
	The state of the s
- A	15
	· · · · · · · · · · · · · · · · · · ·
	El Priese
	Wishnet Sand Regularen
e Quality due	Wishier summer (Ganham
ondition	Transmission 199 Sto Robert John Wallace of Lines
lginal	Farmer and & harles Leslie Elle Croste of Christohur
Clas 22	E41 . Form Salesman 120 long
lan 2	
	Transfer 93455 froduced & December
\ \	1911 at 2 Sifm Robert John Wallace
	and thatles deslie Metrostie to
	George Kidd Asken of Rolleston for
/**	Mortgage 83 you produced & December
5943	1911 at the Storge Kidd askent
(1)	11/ Kr Alkow We Adom Clashen
468	15/2/1920 and allamber at the
0 1	Mortgage \$3 705 produced b December
\ \	1911 dt J. 51 pm George Kidd Askin
	William Thomps Wallace Do
7437	15/2/get get as:
	Transfer 115595 produces 11
	Actober 1917 at 11: 4 Pan Feorge
No.	Kidd askin to faseph tawton
	Ragg of Rolleston farmer
	Francomission 11 ay 2 of Mortgage
	8570 Ata - Saraha braile blan brans
Parent do ou and and	and traces weeser walter becutes
Scate, 10 Chains to an inc	of the will of William albert Parton
	blarkson deceased entered 19 August
4.	1918 at 2.45 fm
	1918 at 2.45 mm 18 Traser 12 ye

232/ 93

32/ 93

(O)



RECORD OF TITLE UNDER LAND TRANSFER ACT 2017 FREEHOLD





Constituted as a Record of Title pursuant to Sections 7 and 12 of the Land Transfer Act 2017 - 12 November 2018

Identifier Land Registration District Date Issued 463353 Canterbury 21 January 2010

Prior References

90576 90577

Estate Fee Simple

Area 30.4300 hectares more or less

Legal Description Lot 2 Deposited Plan 416195 and Lot 2

Deposited Plan 322710

Original Registered Owners

Mark Purdon as to a 1/2 share

Vicki Lynnette Purdon as to a 1/2 share

Interests

Subject to Section 241(2) Resource Management Act 1991 (affects DP 416195)

8389252.6 Mortgage to Bank of New Zealand - 21.1.2010 at 12:26 pm

8903911.1 Discharge of Mortgage 8389252.6 - 16.12.2011 at 5:34 pm

8903911.2 Transfer of the 1/2 share of Vicki Lynnette Purdon to Mark Purdon - 16.12.2011 at 5:34 pm

8903911.3 Mortgage to Bank of New Zealand - 16.12.2011 at 5:34 pm

 $8903911.4\ Mortgage\ to\ James\ Scott\ Dalgety\ -\ 16.12.2011\ at\ 5:34\ pm$

9776431.1 Discharge of Mortgage 8903911.4 - 24.7.2014 at 10:11 am

9776431.2 Transfer to Mark Purdon (1/2 share) and Natalie Clair Rasmussen (1/2 share) - 24.7.2014 at 10:11 am

9776431.3 Mortgage to James Scott Dalgety - 24.7.2014 at 10:11 am

10222310.1 Discharge of Mortgage 9776431.3 - 23.10.2015 at 11:40 am

10222310.2 Variation of Mortgage 8903911.3 - 23.10.2015 at 11:40 am



COMPUTER FREEHOLD REGISTER UNDER LAND TRANSFER ACT 1952

Historical Search Copy



Identifier
Land Registration District
Date Issued

CB3C/219 Canterbury 31 October 1963 Cancelled

Prior References

CB232/93 CB232/94

Estate Fee Simple

Area 32.1093 hectares more or less

Legal Description Part Rural Section 5943 and Part Rural

Section 7437

Original Proprietors

Arthur Ross Bussell as to a 1/2 share Noeline Shirley Bussell as to a 1/2 share

Interests

5182545.1 Transfer to Mark Purdon and Vicki Lynette Purdon - 3.4.2002 at 10:57 am

5182545.2 Mortgage to Arthur Ross Bussell and to Noeline Shirley Bussell in shares - 3.4.2002 at 10:57 am

5194569.1 Department dealing correcting the name of one of the registered proprietors from Vicki Lynette Purdon to Vicki Lynnette Purdon - 18.4.2002 at 11:00 am

5729095.1 Discharge of Mortgage 5182545.2 - 15.9.2003 at 9:00 am

5729095.2 Mortgage to Bank of New Zealand - 15.9.2003 at 9:00 am

6411331.1 Certificate pursuant to Section 224(c) Resource Management Act 1991 (affects DP 322710) - 9.5.2005 at 9:00 am

6411331.2 CTs issued - 9.5.2005 at 9:00 am

Legal DescriptionTitleLot 1 Deposited Plan 32271090576Lot 2 Deposited Plan 32271090577

CANCELLED

Transaction Id Client Reference 488 - Nobeline Dr Reference: Prior C/T.

232/93,94

Transfer No. N/C. Order No. 611964



Land and Deeds 69

REGISTER

3C /2

· ·


This Certificate dated the 31st day of October one thousand nine hundred and sixty-three under the seal of the District Land Registrar of the Land Registration District of Canterbury

CERTIFICATE OF TITLE UNDER LAND TRANSFER ACT


WITNESSETH that JOHN HENRY BUTTERICK of Weedons Farmer

is seised of an estate in fee-simple (subject to such reservations, restrictions, encumbrances, liens, and interests as are notified by memorial underwritten or endorsed hereon) in the land hereinafter described, delineated with bold black lines on the plan hereon, be the several admeasurements a little more or less, that is to say: All that parcel of land containing 79 acres 1 rood

15 perches or thereabouts situated in Block III of the Leeston Survey District being part of Rural Sections 5943 and 7437

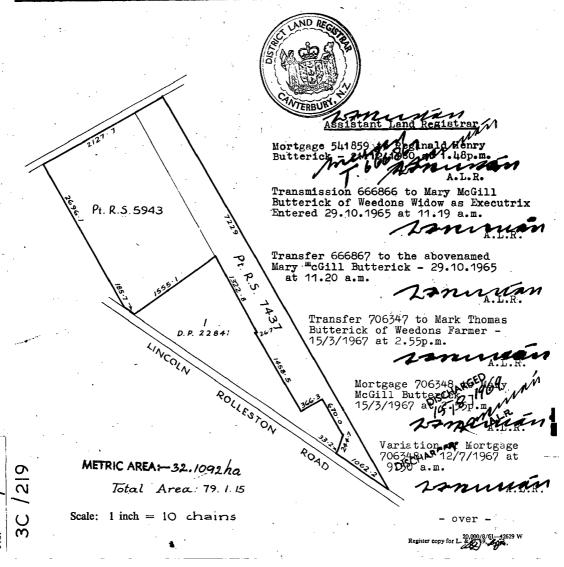


Transaction Id: 61517726

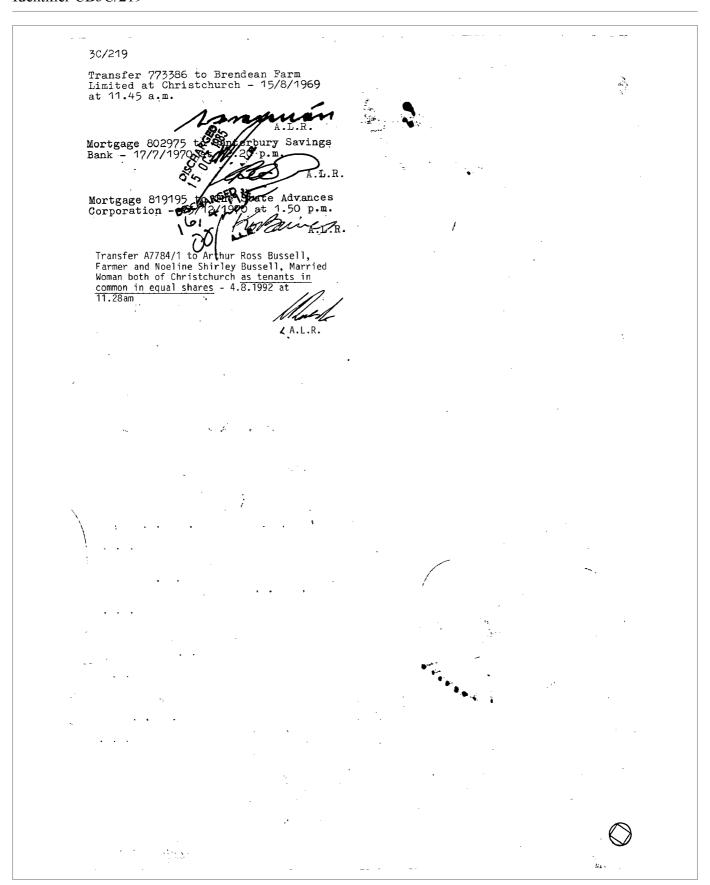



RECORD OF TITLE UNDER LAND TRANSFER ACT 2017 FREEHOLD

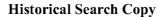



Constituted as a Record of Title pursuant to Sections 7 and 12 of the Land Transfer Act 2017 - 12 November 2018

Identifier
Land Registration District
Date Issued

CB39B/869 Canterbury 29 September 1994

Prior References

CB3C/216

Estate Fee Simple

Area 4.0000 hectares more or less **Legal Description** Lot 1 Deposited Plan 67190

Original Registered Owners

Stephen Roger Chapman and Nicola Mary Chapman

Interests

Land Covenant in Transfer A172055.1 - 10.5.1995 at 10.05 am

A448281.2 Mortgage to Mortgage Holding Trust Company Limited - 2.3.2000 at 1.40 pm

7655529.1 Bond pursuant to Section 108(2)(b) Resource Management Act 1991 - 13.12.2007 at 9:00 am

8630923.1 Discharge of Mortgage A448281.2 - 9.11.2010 at 11:40 am

8630923.2 Mortgage to ANZ National Bank Limited - 9.11.2010 at 11:40 am

9024953.1 Transfer to Stephen Roger Chapman and Nicola Mary Chapman - 19.4.2012 at 9:30 am

9024953.2 Variation of Mortgage 8630923.2 - 19.4.2012 at 9:30 am

Transaction Id

Historical Search Copy Dated 31/08/20 8:23 pm, Page 1 of 3

Client Reference 488 - Nobeline Dr

References Prior C/T 3C/216

Transfer No. N/C. Order No. A136810/ 2



Land and Deeds 69

REGISTER

CERTIFICATE OF TITLE UNDER LAND TRANSFER ACT

This Certificate dated the 29th day of September one thousand nine hundred and ninety-four under the seal of the District Land Registrar of the Land Registration District of CANTERBURY

WITNESSETH that ALEXANDER GRAHAM DUNLOP of Springston, Farmer and ADRIENNE ELIZABETH

DUNLOP, his wife are ---

is seised of an estate in fee-simple (subject to such reservations, restrictions, encumbrances, liens, and interests as are notified by memorial underwritten or endorsed hereon) in the land hereinafter described, delineated with bold black lines on the plan hereon, be the several admeasurements a little more or less, that is to say: All that parcel of land containing 4.0000

hectares or thereabouts being Lot 1 Deposited Plan 67190 ---

DISTRICT LAND RESIDENCE ASSISTANT LAND REGISTRAR CARTES

Subject to:

Mortgage A124464/2 tes 20.7.1994 at 10

Transfer A172055/1 to Alexander Graham Dunlop of Springston, Farmer and Adrienne Elizabeth Dunlop his wife (Land Covenant) - 10.5.1995 at 10.05am

Transfer A172056/2 to Stephen Roger Chapman of Christchurch, Company Manager and Nicola Mary Chapman his wife -10.5.1995 at 10.05am

for A.L.R.

Mortgage A172056/3 to Countrywide Banking Corporation Long Geo. 10,5,995 at 10.05ar 10.561995 at 10.05am Helman


for A.L.R. Mortgage A247420/2 to Zealand Limited - 114

at⇔1.57pm SWITE

A448281.2 Mortgage to Mortgage Holding Trust Company Limited - 2.3.2000 at 1.40


for RGL

Transaction Id: 61517726

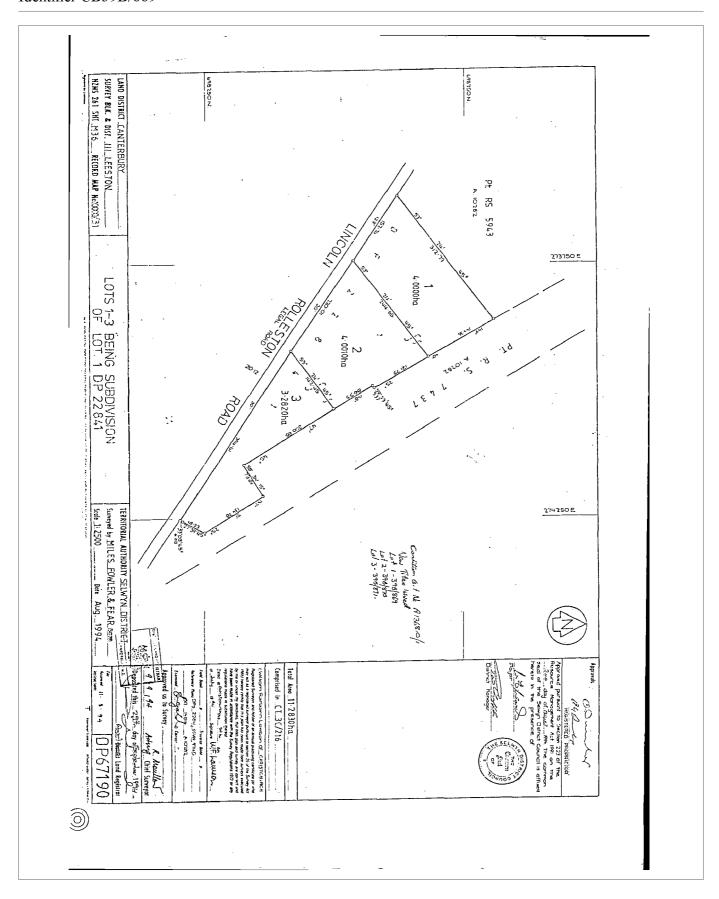



RECORD OF TITLE UNDER LAND TRANSFER ACT 2017 FREEHOLD

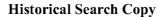



Constituted as a Record of Title pursuant to Sections 7 and 12 of the Land Transfer Act 2017 - 12 November 2018

Identifier Land Registration District Date Issued CB39B/870 Canterbury 29 September 1994

Prior References

CB3C/216

Estate Fee Simple

Area 4.0010 hectares more or less **Legal Description** Lot 2 Deposited Plan 67190

Original Registered Owners

Alexander James Cook and Pamela Cook

Interests

Land Covenant in Transfer A172055.1 - 10.5.1995 at 10.05 am

A456046.1 Mortgage to Westpac Banking Corporation - 1.5.2000 at 9.50 am

6365510.1 Variation of Mortgage A456046.1 - 4.4.2005 at 9:00 am

7095691.1 Application pursuant to Section 99A Land Transfer Act 1952 vesting Mortgage A456046.1 in

Westpac New Zealand Limited - 2.11.2006 at 9:00 am

7688135.1 Discharge of Mortgage A456046.1 - 28.1.2008 at 10:45 am

7688135.2 Transfer to Sharon Linda Jones and Canterbury Trustees (2006) Limited - 28.1.2008 at 10:45 am

7688135.3 Mortgage to Bank of New Zealand - 28.1.2008 at 10:45 am

10583306.1 Transfer to Sharon Linda Jones and Emma Grace Louise Jones - 26.10.2016 at 11:29 am

11392588.1 Discharge of Mortgage 7688135.3 - 2.4.2019 at 9:28 am

11392588.2 Transfer to 2 Degrees Real Estate Limited - 2.4.2019 at 9:28 am

11392588.3 Mortgage to Bank of New Zealand - 2.4.2019 at 9:28 am

Transaction Id

Historical Search Copy Dated 31/08/20 8:22 pm, Page 1 of 3

Client Reference 488 - Nobeline Dr

References Prior C/T 3C/216

Transfer No. N/C. Order No. A136810/3



Land and Deeds 69

REGISTER

CERTIFICATE OF TITLE UNDER LAND TRANSFER ACT

This Certificate dated the 29th day of September one thousand nine hundred and ninety-four under the seal of the District Land Registrar of the Land Registration District of CANTERBURY

WITNESSETH that ALEXANDER GRAHAM DUNLOP of Springston, Farmer and ADRIENNE ELIZABETH DUNLOP, his wife are ---

is seised of an estate in fee-simple (subject to such reservations, restrictions, encumbrances, liens, and interests as are notified by memorial underwritten or endorsed hereon) in the land hereinafter described, delineated with bold black lines on the plan hereon, be the several admeasurements a little more or less, that is to say: All that parcel of land containing 4.0010 hectares or thereabouts being Lot 2 Deposited Plan 67190 ---

> TRICT LAND REGISTRAR ASSISTANT LAND REGISTRAR

Subject to:

Mortgage A124464/2 20.7.1994 at 10.35

Transfer A172055/1 to Alexander Graham Dunlop of Springston, Farmer and Adrienne Elizabeth Dunlop his wife (Land Covenant) - 10.5.1995 at 10.05am

for A.L.R.

Transfer A172055/3 to Kevin John Morland, Clerk and Wilhelmina Annechiena Geziena Morland, Married Woman, both of Christchurch - 10.5.1995 at 10.05am

onsice for RGL

CANTERBURY N.Z.

A456046.1 Mortgage to Westpac Banking Corporation - 1.5.2000 at 9.50


A452752.2 Transfer to Alexander James Cook and Pamela Cook - 4.4.2000 at 11.20

for A.L.R. Mortgage A172055/4 to 06 Corporation - 1000-1995

Variation of Mortgage A1

at 9.30am

Transaction Id: 61517726

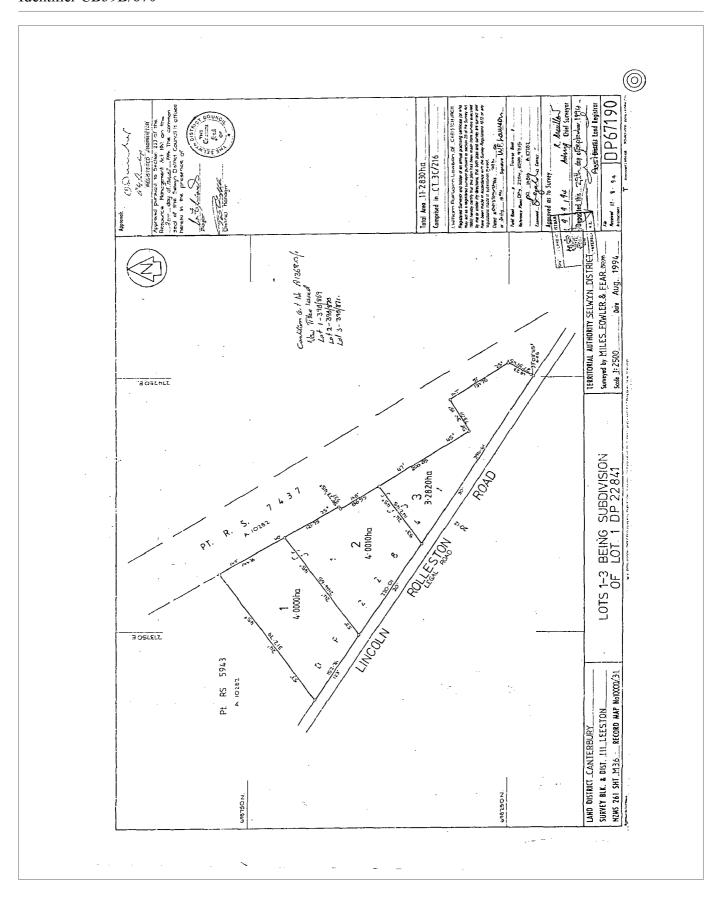

Reference: | Fel. , folio CLyptication No 10282 Prante No.



egister-book, Vol. 232, folio 94

This Certificate, date	d sho eighth day of	one thousand	nd nine hundred and, under
•	i .	Registration District of	Anna, Witnesseth that
_		* **	The state of the s
	WWWW WY Y	wellen winder	
	<u> </u>		
is seized of an estate in fer	e-simple (subject to such reservations,)	estrictions, encumbrances, liens, and int	erests as are notified by memorial underwritten
	•		provisions of any Act of the General Assembly
	• •	•	be the several admeasurements
	- <u>-</u>	4-	25 things/nowato am
Minhala	en CANDARA VO	Menealine South	ander any Blue At I we
Mar Seeding	Burney Destree	& being Kurat toe	elim 5943
		<u> </u>	-
X ·	A STATE OF S	<u> </u>	
i)			
			Elmise.
		7.57	
	7500	W xoh	set Sound Regulations
		Outstanding	Minigage Regative 1000
	Plan 20641.	1/2	
-	The De	S.J.D.S.CHARQ	ingand of friends
Quality due	P	المستعمل فيوروراو	on Dex
ondition	,		s to Robert John Wellacoof
iginal		Lincoln Farmeran	d Charles Leslie Che Prostie
			Farm Salaman 122 1
- · · · · · · · · · · · · · · · · · · ·			aisti
		Transfer 921	155 produced b Decem
		1911at 2.51 pm	Robert John Wallaces
		CharlesLeslie	Mc Cobutie to George
· /	• !	Hidd Askin	of Rolleston farmer
7550	5943	·	Laamen old
7556		Mortgage 83	704 produced & December
	60.8.82	_iguall & olfre	Jorge Kidd Askin I
			bert Safton Clarkson
		7437 15/2/1926	pe, out oand and
+	52	Mortgage 83	105 produced belevem
•	212	1911al 2 Sepan	Jeorge Midd Askin
1.		William Vh	omas Wallace
		15/1926	12 to and and
1	•	dranafer 11	5595 produced 116
		October 1917	at 11 63 am Beorge
		Kidd askin	de Jesel W Lawton
Scale 10 Ch	ains to an inch.	RaggolRol	les lon farmer
			

232/ 94

mantgage 190 H91 produced 1935 al WHOCH KARE Waller Executors will of Williams albert Paston Cotterell 21-3-1941 (1965) Edward 1918 at 2 45 fm Cotterill Transfer 118403 of mortgage Wallen Clarkson Ironsfet 238 769 produced 21 March 1941 at 12 70 pm. George Taylor to William albert Taylor of Rolliston Former. aza Variation & Calter A. R. G. Filon 83705 fratucu 6 august 1923 at 2.15 mortgage 208 367 forsduced 21 mars to George Destate to tage De 105 por duced is 459907 Transfer mortgage for 541858 Reginal Henry Butterick to Joh Butterick of Weadon's Farmer produced 21/12/1960 at 1.46p.m. 20 Smay 1925 ax Butterick produced 21/12/1960 at 1.48 p. n. / Ino iory igel as rtgage 149822 produced Joseph Landon as Countier Entered 397/1963 1130an De produced to February 1926 at number 61961 of Montage 34,859 to the altrament Many McGill Bullerick - 31.10.1963 at 0.59am. Discharge of Mortgage 541859 as to Lot 1. D. P.
228410 30 10 1963 at 10 59 and
Transfer 611962 of Lot 1. D.P. 22841 to Raymond
Groods Morris disc Meric Emilie Morris produced to February 1926 at Transfer 611962 of Lat 1. George Morris dill Mer 31 10 1963 at 10:59 am. alk 72544 produced 22 July 1926 at 2 55 pm Brusha as Edward Taylor of Carrelled and new C.T. 30/219 respied Weedon's from Su N.CO. 611964 - 31.10.1963 at Danusin 197967 pro Douglas Edul Canalled Duplicate Destroyed.

232194

0

	PSI – Levi & Lincoln Rolleston Roads, Rolleston
Appendix B – Historic Aerials	



Information has been derived from various organisations, including Environment Canterbury and the Canterbury Maps partners. Boundary information is derived under licence from LINZ Digital Cadastral Database (Crown Copyright Reserved). Environment Canterbury and the Canterbury Maps partners do not give and expressly disclaim any warranty as to the accuracy or completeness of the information or its fitness for any purpose.

0 0.09 0.17 0.26 Scale: 1:6,000 @A4 0.34 Kilometres





Information has been derived from various organisations, including Environment Canterbury and the Canterbury Maps partners. Boundary information is derived under licence from LINZ Digital Cadastral Database (Crown Copyright Reserved). Environment Canterbury and the Canterbury Maps partners do not give and expressly disclaim any warranty as to the accuracy or completeness of the information or its fitness for any purpose.

0.09 0.17 Scale: 1:6,000 @A4 0.34

Kilometres

0.26





Information has been derived from various organisations, including Environment Canterbury and the Canterbury Maps partners. Boundary information is derived under licence from LINZ Digital Cadastral Database (Crown Copyright Reserved). Environment Canterbury and the Canterbury Maps partners do not give and expressly disclaim any warranty as to the accuracy or completeness of the information or its fitness for any purpose.

Information from this map may not be used for the purposes of any legal disputes. The user should independently verify the accuracy of any information before taking any action in reliance upon it.



0.34

Kilometres 0.26

Scale: 1:6,000 @A4





Information has been derived from various organisations, including Environment Canterbury and the Canterbury Maps partners. Boundary information is derived under licence from LINZ Digital Cadastral Database (Crown Copyright Reserved). Environment Canterbury and the Canterbury Maps partners do not give and expressly disclaim any warranty as to the accuracy or completeness of the information or its fitness for any purpose.

Information from this map may not be used for the purposes of any legal disputes. The user should independently verify the accuracy of any information before taking any action in reliance upon it.

Ν

0.34 Kilometres 0.09 0.26 0.17

Scale: 1:6,000 @A4





Information has been derived from various organisations, including Environment Canterbury and the Canterbury Maps partners. Boundary information is derived under licence from LINZ Digital Cadastral Database (Crown Copyright Reserved). Environment Canterbury and the Canterbury Maps partners do not give and expressly disclaim any warranty as to the accuracy or completeness of the information or its fitness for any purpose.

Information from this map may not be used for the purposes of any legal disputes. The user should independently verify the accuracy of any information before taking any action in reliance upon it.

Ν

0.34 Kilometres 0.09 0.26 0.17

Scale: 1:6,000 @A4

Map Created by MEL on 2/09/2020 at 2:34 PM





Ν

Information has been derived from various organisations, including Environment Canterbury and the Canterbury Maps partners. Boundary information is derived under licence from LINZ Digital Cadastral Database (Crown Copyright Reserved). Environment Canterbury and the Canterbury Maps partners do not give and expressly disclaim any warranty as to the accuracy or completeness of the information or its fitness for any purpose.

Information from this map may not be used for the purposes of any legal disputes. The user should independently verify the accuracy of any information before taking any action in reliance upon it.

0 0.09 0.17 0.26 0.34 Kilometres

Scale: 1:6,000 @A4

Map Created by MEL on 2/09/2020 at 2:35 PM






Information has been derived from various organisations, including Environment Canterbury and the Canterbury Maps partners. Boundary information is derived under licence from LINZ Digital Cadastral Database (Crown Copyright Reserved). Environment Canterbury and the Canterbury Maps partners do not give and expressly disclaim any warranty as to the accuracy or completeness of the information or its fitness for any purpose.

0.09 0.17 Scale: 1:6,000 @A4 0.34

Kilometres

0.26

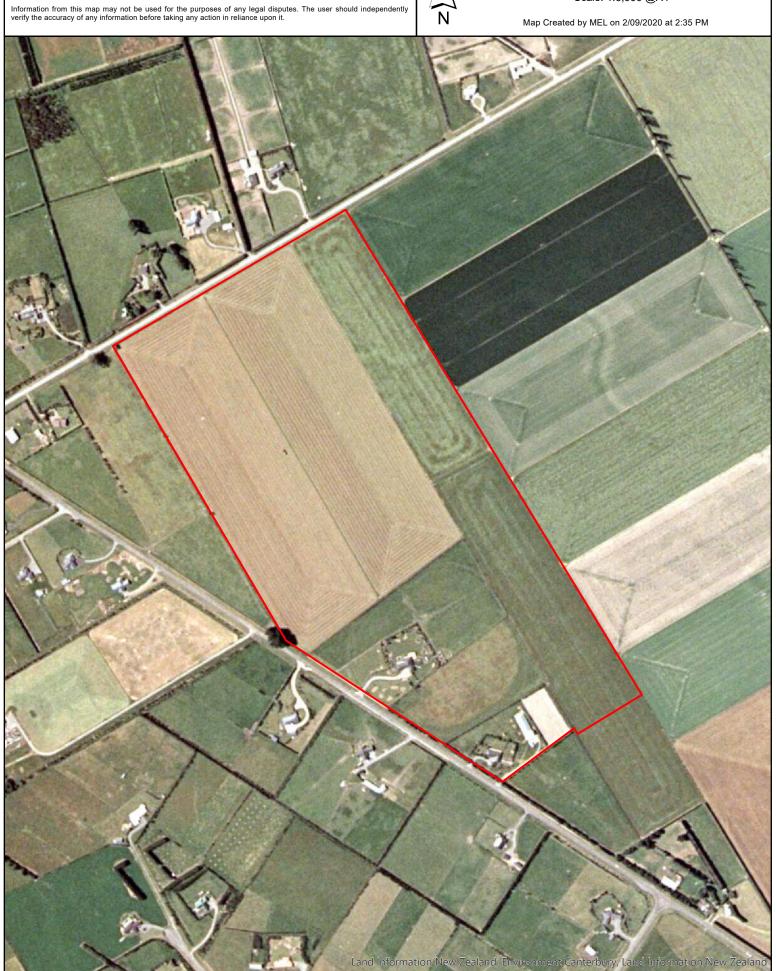



Information has been derived from various organisations, including Environment Canterbury and the Canterbury Maps partners. Boundary information is derived under licence from LINZ Digital Cadastral Database (Crown Copyright Reserved). Environment Canterbury and the Canterbury Maps partners do not give and expressly disclaim any warranty as to the accuracy or completeness of the information or its fitness for any purpose.

0 0.09 0.17 0.26 Scale: 1:6,000 @A4 0.34 ☐ Kilometres





Information has been derived from various organisations, including Environment Canterbury and the Canterbury Maps partners. Boundary information is derived under licence from LINZ Digital Cadastral Database (Crown Copyright Reserved). Environment Canterbury and the Canterbury Maps partners do not give and expressly disclaim any warranty as to the accuracy or completeness of the information or its fitness for any purpose.

Information from this map may not be used for the purposes of any legal disputes. The user should independently verify the accuracy of any information before taking any action in reliance upon it.

Ν

0.34 Kilometres 0.09 0.26 0.17

Scale: 1:6,000 @A4

Map Created by MEL on 2/09/2020 at 2:36 PM



	PSI – Levi & Lincoln Rolleston Roads, Rolleston
Appendix C – LLUR Statement	

Property Statement from the Listed Land Use Register

Visit www.ecan.govt.nz/HAIL for more information about land uses.



Customer Services
P. 03 353 9007 or 0800 324 636

PO Box 345 Christchurch 8140

P. 03 365 3828 F. 03 365 3194

E. ecinfo@ecan.govt.nz

www.ecan.govt.nz

Date: Land Parcels:

02 September 2020	
Lot 1 DP 67190	Valuation No(s): 2405509800
Lot 2 DP 67190	Valuation No(s): 2405509700
Lot 2 DP 322710	Valuation No(s): 2405506501



The information presented in this map is specific to the area within a 100m radius of property you have selected. Information on properties outside the serach radius may not be shown on this map, even if the property is visible.

Summary of sites:

Site ID	Site Name	Location	HAIL Activity(s)	Category
118906	274 Lincoln Rolleston Rd	274 Lincoln Rolleston Rd		Verified Non-HAIL

Please note that the above table represents a summary of sites and HAILs intersecting the area of enquiry within a 100m buffer.

Information held about the sites on the Listed Land Use Register

Site 118906: 274 Lincoln Rolleston Rd (Intersects enquiry area.)

Site Address: 274 Lincoln Rolleston Rd

Legal Description(s): Lot 2 DP 67190

Site Category: Verified Non-HAIL

Definition: Site entered on register based on information found to be incorrect.

Land Uses (from HAIL): Period From Period To HAIL land use

Notes:

5 Nov 2014 This record was created as part of the Selwyn District Council 2015 HAIL identification project.

5 Nov 2014 Greenhouse

5 Nov 2014 Area defined from 2000 to 2005 aerial photographs. Horticultural activities (persistent pesticides) were noted in aerial photographs

reviewed

8 Nov 2018 Information from the landowner that developed and operated the greenhouses has shown that persistent pesticides were

not used at the site. A list of products used was supplied to Environment Canterbury. The former onwers purchased the property in 1999 and erected the first greenhouse in 2000. Flowers were grown in trays on raised benches. The property was sold in 2008 and the greenhouses were dismantled in 2010 and 2011. The activity of 'persistent pesticide storage or use' has

been removed and this record maintained for auditing purposes.

Investigations:

There are no investigations associated with this site.

Information held about other investigations on the Listed Land Use Register

1 Jan 2011 INV 12787: Desk-Based Ground Contamination Assessment Plan Change 7 Area (Preliminary Site

Investigation)

Tonkin and Taylor Ltd

Summary of investigation(s):

Selwyn District Council requested a desk-based study of sites of potential contamination within the Plan Change 7 area. Plan Change 7 is located around the towns of Rolleston and Lincoln and proposed to rezone these areas for standard residential land use on 58 existing 'Living Z' and Deferred Living Z' land parcels in 2011. Environment Canterbury and Selwyn District Council records were reviewed along with historical aerial photographs and certificates of title. Site walkovers were also conducted. Potential sources of contamination were identified in several areas and these have been assigned a site number on the Listed Land Use Register. The majority of the areas investigated were found to be in pasture for most of their recent history.

23 Nov 2012 INV 14520: GW Rolleston Ltd - Preliminary Site Investigation Report - 116 Levi Road, Rolleston (Detailed

Site Investigation)

Spiire

Summary of investigation(s):

A Preliminary Site Investigation was made at 116 Levi Road, Rolleston (Lot 1 DP 68746) to investigate potential sources of contamination. The property has subsequently been developed from agricultural land to a residential subdivision.

A review was made of Selwyn District Council records, Environment Canterbury records, historical aerial photographs, and certificates of title. A site inspection was also performed.

The property historically had been used for agriculture and no specific sources of contamination were identified. At the time of the investigation the site was predominantly used for raising and training race horses and contained an associated barn and training track.

The PSI was performed in accordance with Contaminated Land Management Guidelines. No Hazardous Activities and Industries List sites were identified.

18 Nov 2016 INV 152523: Preliminary and Detailed Site Investigation, Branthwaite Drive, Rolleston (Preliminary Site Investigation)

Unknown

Summary of investigation(s):

Environment Canterbury has received a Preliminary Site Investigation report that includes all or part of the property you have selected.

A Preliminary Site Investigation seeks to identify potential sources of contamination resulting from current and historical land uses.

The preliminary site investigation may not have found any potential sources of contamination on the property you have enquired about. Where potential sources of contamination have been identified, a site identification number (e.g. SIT 1234) and land uses from the Hazardous Activities and Industries List (HAIL) will be shown on your statement.

This investigation has not been summarised.

15 Oct 2016

INV 160048: Soil Contamination Risk, Stage 1 - Preliminary Site Investigation Report, Branthwaite Drive,

Rolleston (Preliminary Site Investigation)

Malloch Environmental Ltd

Summary of investigation(s):

Site history: The site appears to have been used for grazing from at least the 1940's through to around the 1980's. A farm homestead is visible on the southern side of what is now Branthwaite Drive. In the 1990's the site appears to have been subdivided for rural residential use, and new dwellings can be seen being constructed alongside the newly constructed Branthwaite Drive. The original homestead and associated sheds appear to have been demolished at this point. In the 2000 aerial imagery a hazelnut orchard has been established on a lot in the southwestern part of the site, which remains to the present day.

INV160048 - Soil Contamination Risk, Stage 1 - Preliminary Site Investigation Report, Branthwaite Drive, Rolleston - Revision 2 (Malloch Environmental, 2017)

Investigation objective: The investigation was undertaken in preparation for soil disturbance and subdivision of the land into 700 residential lots. The site was investigated and soil contaminants assessed against the requirements of the National Environmental Standards for Assessing and Managing Contaminants in Soil to Protect Human Health (MfE, 2011).

The majority of the site was not found to have been used for any HAIL activities. However the former homestead and farm sheds area was considered to have been potentially subject to fertiliser and chemical storage, and it was recommended that further investigation be undertaken in this area.

An interview was conducted with the owner of the hazelnut orchard (SN120675) in order to establish whether the trees had been sprayed with any persistent pesticides. The owner stated that the trees had only been sprayed with Roundup (glyphosate), Granstar (tribenuron-methyl) and Gestop (simazine). Glyphosate and tribenuron-methyl have half-lives of around three weeks in soil, and simazine has a half-life in soil of around 60 days. None of these chemicals are considered to be persistent in the soil. In addition, the owner only sprayed the trees annually, as hazelnut trees are not susceptible to disease or pests.

1 Feb 2013

INV 15063: Soil Contamination Risk Stage 1 Preliminary Site Investigation - 132 Levi Road Prebbleton

(Detailed Site Investigation)

Davie Lovell Smith

Summary of investigation(s):

Report(s) have not yet been audited.

For further information from Environment Canterbury, contact Customer Services and refer to enquiry number ENQ262601.

Disclaimer:


The enclosed information is derived from Environment Canterbury's Listed Land Use Register and is made available to you under the Local Government Official Information and Meetings Act 1987 and Environment Canterbury's Contaminated Land Information Management Strategy (ECan 2009).

The information contained in this report reflects the current records held by Environment Canterbury regarding the activities undertaken on the site, its possible contamination and based on that information, the categorisation of the site. Environment Canterbury has not verified the accuracy or completeness of this information. It is released only as a copy of Environment Canterbury's records and is not intended to provide a full, complete or totally accurate assessment of the site. It is provided on the basis that Environment Canterbury makes no warranty or representation regarding the reliability, accuracy or completeness of the information provided or the level of contamination (if any) at the relevant site or that the site is suitable or otherwise for any particular purpose. Environment Canterbury accepts no responsibility for any loss, cost, damage or expense any person may incur as a result of the use, reference to or

reliance on the information contained in this report.

Any person receiving and using this information is bound by the provisions of the Privacy Act 1993.



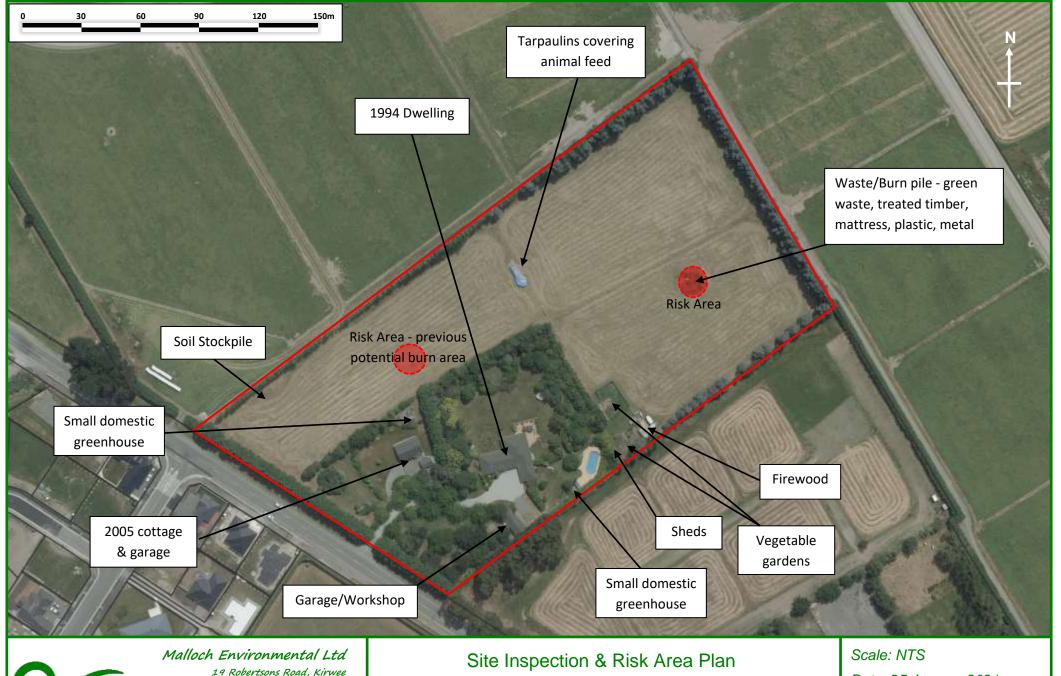

Om.e./

19 Robertsons Road, Kirwee RD1, Christchurch 7671 021 132 0321 www.mallochenviro.co.nz Site Inspection & Risk Area Plan 294 Lincoln Rolleston Road, Christchurch

Date: 25 January 2021

Drawing No: 01487/1